



febi 40672

to fit:

Seat Altea, Škoda Octavia,
VW Golf PLUS, Golf V, Passat 5
and more



Repl. No. 03C 109 158 A S1



EN



new version
OE reference 03C 109 088 E
febi 45084



Chain Tensioner febi 36484



Timing Chain 40390

TIMING CHAIN KIT

PROBLEM

Problems with the timing chain in vehicles with 1.4 TSI engines.

CAUSE

The series manufacturer has reported quality problems with the individual components. Worn tools used during production have left behind metal burrs on the chain links. This leads to premature wear on the chain.

SOLUTION

Make sure that you have installed the latest version of the camshaft adjusters. The manufacturer has replaced the camshaft adjusters which have the OE number 03C 109 088 E (febi 45084). The manufacturer explicitly states that the new version must be installed.

ATTENTION

Afterwards, carry out a system update of the engine control unit to ensure that the engine runs properly!

For more technical information please visit: partsfinder.bilsteingroup.com