



febi 47797, 45158, 47673

**to fit:**

Fiat Ducato, Iveco Daily 3.0 Diesel
2006-



EN

THROTTLE BODY

Problem

Reduced performance with the vehicle in limp home mode, throttle body not functioning, fault code P0638 throttle actuator control range / performance logged in the engine management ECU.

Cause

Water ingress into the electrical connectors of the connecting cable and throttle body. This results of corrosion in the wiring loom connector and connector pins causing loss of connectivity. The moisture can also cause corrosion damage in the throttle body control, leading to eventual component failure.

Solution

Replace faulty throttle body and connector cable as required.

For more technical information please visit: partsfinder.bilsteingroup.com